

### TI-1089: “E 99” on TD3030 Dryer

The TD3030 dryer signals a loss of communication between the display circuit board and the main control circuit board by flashing error code “E 99”.

On TD3030 dryers with serial numbers between 23300/004000 and 23300/006127, it is possible for this error to occur due to extremely cold weather (temperatures below 32 degrees Fahrenheit).

If “E 99” is displayed in extremely cold weather, and then clears as the laundry room warms up, install E99 repair kit part number 487 171442. Note that TWO kits are required for each dryer, one for the top pocket and one for the bottom.

These repair kits may be obtained under warranty by contacting Wascomat’s Technical Support Department at 516-371-0700. Please have the serial number(s) of the affected machine(s) available when calling.