


### TI 1096 – TD3030 lint drawer switch operation

On early model TD3030 dryers, lint accumulation in the lint drawer slide tracks may prevent the lint drawer from closing far enough to activate the lint drawer switch(es). If this occurs, the dryer will not start, and, on some versions, an “E15” airflow error may be displayed.

To eliminate this problem:

1. Disconnect electrical power from the dryer
2. Remove the lint drawer from the machine.
3. Use a small screwdriver, or other suitable implement to clean the accumulated and compacted lint from the rear of the drawer tracks in the dryer. CAUTION – wear work gloves! Edges of steel may be sharp!
4. Use the special Track Adjustment Tool, part number 098612 (available on loan from Wascomat) to bend the trailing end of the lint drawer track downward to allow lint to fall out of the track when the drawer is slid into the dryer.

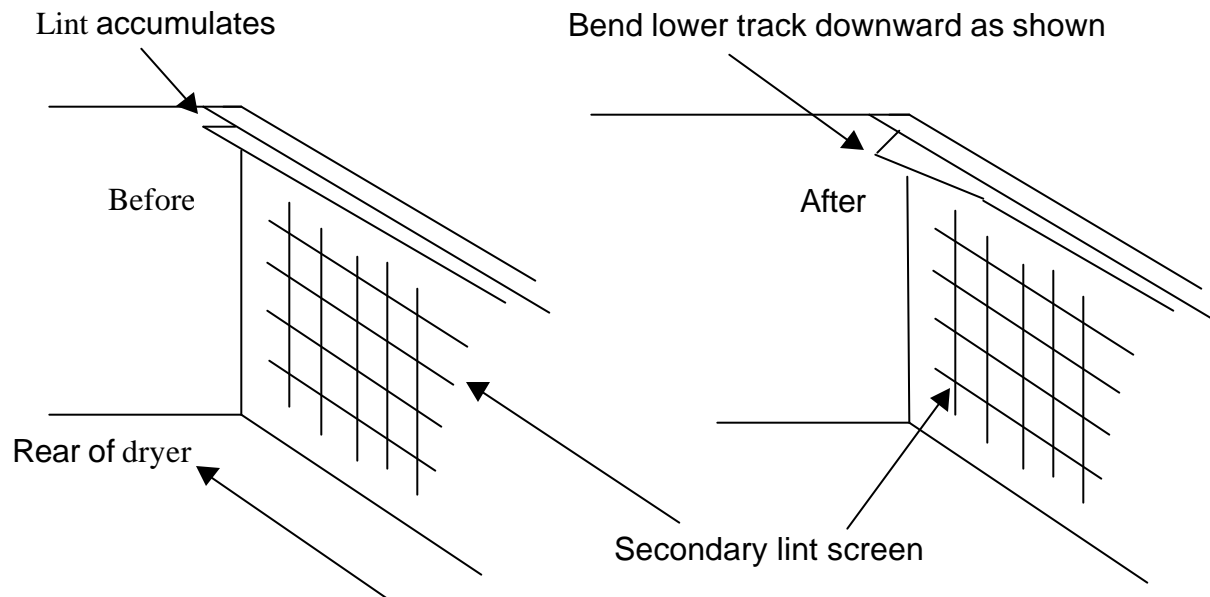

Call Wascomat Technical Support at 516-371-0700 for assistance.

4/01/03