


TI 1098 - TD3030 locks

MACHINES AFFECTED: TD3030 from S/N 23300/002677 to S/N 23300/006352, inclusive.

On TD3030 dryers from serial number 23300/002677 to 23300/006352, there is a tendency for the lock-catch retaining screw to loosen and fall out of the lint drawer (and possibly the control-panel) lock. When this occurs, the tumbler assembly may fall out of the front of the lock cylinder, and come apart, requiring replacement.

At the next service visit, it is recommended that the catch-retaining screw be removed, and re-installed using a small amount of thread-locking compound on the screw threads (Loctite 222 or equivalent). Use care to prevent the tumbler from falling out of the lock cylinder while the screw is removed.

If necessary, replace the complete lock assembly and catch, re-assembling the unit as shown. Note that the replacement catch for the lint drawer has a slight bend in it, and that the toothed lockwasher between the catch and the lock cylinder is to be removed from the assembly when the new catch is installed.

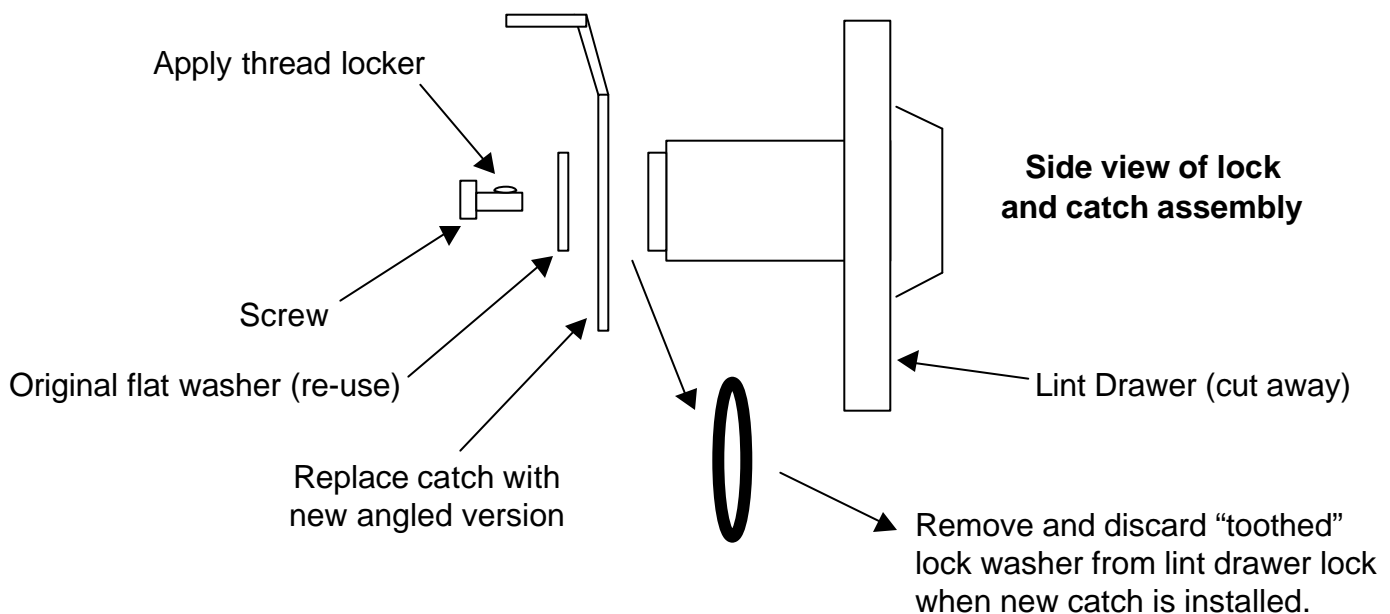

Control door lock with keys: 487 194652

Control door catch: 487 175628

Lint drawer lock with keys: 487 194653

Lint drawer catch: 487 175633

Call Wascomat Technical Support at 516-371-0700 for additional assistance.

4/23/03