


TI 1100 - TD3030 Lint drawer noise

MACHINES AFFECTED: TD3030

On some TD3030 dryers, the lint drawer gasket corners were cut too deeply during manufacturing. This can allow air to pass through the resulting gaps in the gasket, creating a “whistling” noise.

To correct this problem, replace the gasket with a new one (Wascomat part number 487 151079). Use a diagonal cutter or razor blade to cut the 4 corners of the new gasket, as shown.

Also, be sure that the ends of the replacement gasket fit snugly together. The seam should be located in the middle of the lower gasket track on the drawer, as shown below-right.

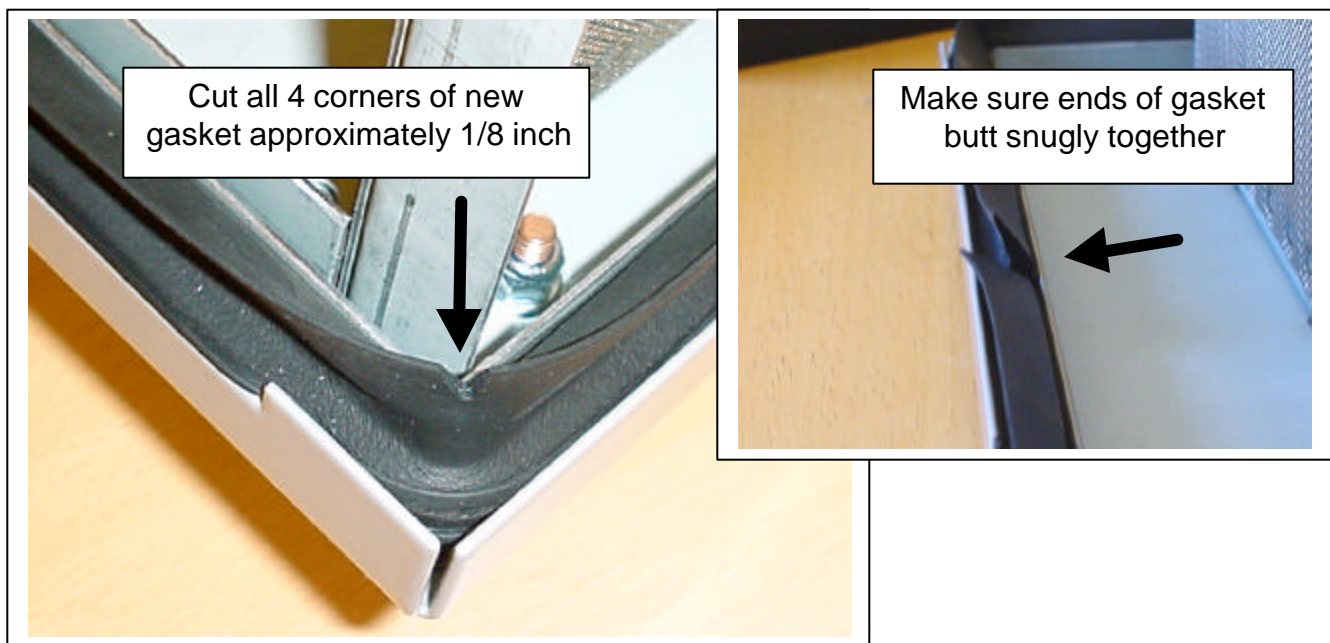

Call Wascomat Technical Support at 516-371-0700 for additional assistance.

4/15/03